


Atmospheric Environments

USAGE GUIDE



COLORCOTE®
PRE-PAINTED METAL PRODUCTS

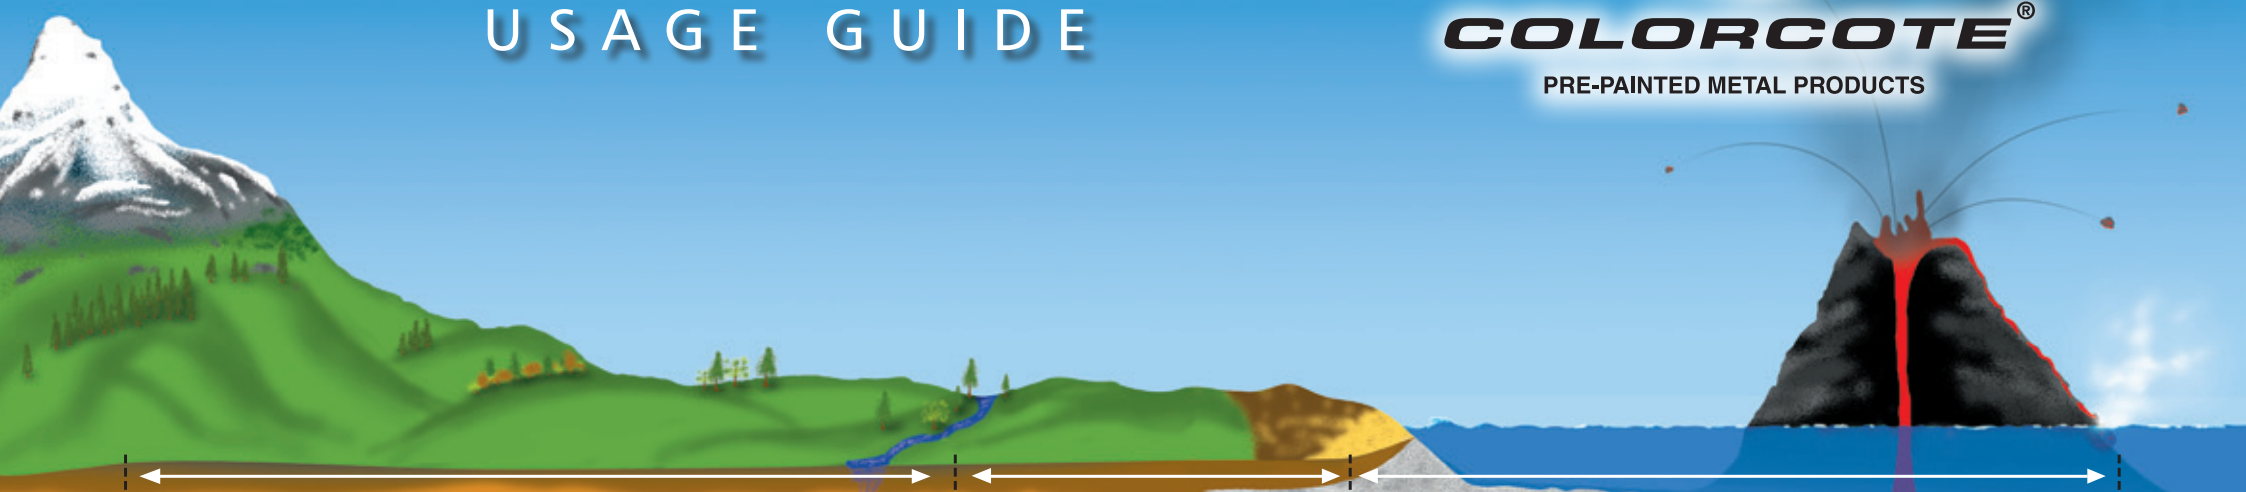

MILD ISO Category 1-2	MODERATE ISO Category 2	INDUSTRIAL ISO Category 3-4	MARINE ISO Category 3	SEVERE MARINE ISO Category 4	VERY SEVERE ISO Category 5	
Areas far inland	Inland other than far inland	Areas around major industrial complexes	Areas influenced by coastal salts	Begins anywhere from 100-400 metres in from the beach front of breaking surf and can extend inland	Very Severe Marine Offshore and anywhere within 100-400 metres from the water line of areas of breaking surf but can extend inland	Industrial and Geothermal
PRODUCT TYPE 2-4				5	6	

These are general guidelines only. Building location, design & aspect also need to be taken into consideration. If in doubt contact Pacific Coilcoaters for specific advice.

AS/NZS 2728 : 2007

- The classification of atmospheric zones and the effect the environment has on pre-painted metal.
- Enables the selection of the correct substrate and coating system for the environment.
- Identification of local environments (or microclimates).



Pacific Coilcoaters
PO Box 12046. 968 Great South Road, Penrose, Auckland
Telephone 64-9-579 9199, Facsimile 64-9-579 7515.
COLORCOTE®, ZR8™, ZR X™, ZM8™, ZM X™, AR8™ and AR X™
are Registered Trade Marks of Fletcher Steel Ltd.
© Copyright Pacific Coilcoaters June 2011



PACIFIC COILCOATERS

WARRANTY TERMS

RESIDENTIAL BUILDINGS

That COLORCOTE® ZR8™, ZRX™, ZM8™, ZMX™, AR8™ and ARX™ pre-painted metal products used in the manufacture of **RESIDENTIAL BUILDINGS** will perform as follows:

1. Resistance to flaking, peeling and excessive fade								
ENVIRONMENT	Roofing				Wall Cladding			
	ZR8	ZM8 ZRX ZMX	AR8	ARX	ZR8	ZM8 ZRX ZMX	AR8	ARX
Mild, Moderate, Industrial, Marine ISO cat. 1-3	18yrs	20yrs	18yrs	20yrs	15yrs	20yrs	18yrs	20yrs
Severe Marine ISO cat. 4	N/R	15yrs	15yrs	20yrs	N/R	15yrs	15yrs	20yrs
Very Severe ISO cat. 5	N/R	N/R	15yrs	15yrs	N/R	N/R	15yrs	15yrs

2. Will not perforate as a result of corrosion							
ENVIRONMENT	Roofing			Wall Cladding			
	ZR8	ZM8 ZRX ZMX	AR8 ARX	ZR8	ZM8 ZRX ZMX	AR8 ARX	AR8 ARX
Mild, Moderate, Industrial, Marine ISO cat. 1-3	30yrs	30yrs	30yrs	15yrs	20yrs	25yrs	
Severe Marine ISO cat. 4	N/R	20yrs	30yrs	N/R	15yrs	20yrs	
Very Severe ISO cat. 5	N/R	N/R	20yrs	N/R	N/R	15yrs	

That COLORCOTE® ZR8™, ZRX™, ZM8™, ZMX™, AR8™ and ARX™ pre-painted metal products used in the manufacture of **RAINWATER PRODUCTS** (guttering, downpipes and fascia) will perform as follows:

1. Resistance to flaking, peeling and excessive fade			
ENVIRONMENT	Gutter, Downpipes and Fascia		
	ZR8	ZM8 ZRX ZMX	AR8 ARX
Mild, Moderate, Industrial, Marine ISO cat. 1-3	10yrs	12yrs	12yrs
Severe Marine ISO cat. 4	N/R	10yrs	10yrs
Very Severe ISO cat. 5	N/R	N/R	10yrs

2. Will not perforate as a result of corrosion						
ENVIRONMENT	Guttering and Downpipes			Fascia		
	ZR8	ZM8 ZRX ZMX	AR8 ARX	ZR8	ZM8 ZRX ZMX	AR8 ARX
Mild, Moderate, Industrial, Marine ISO cat. 1-3	10yrs	12yrs	15yrs	15yrs	15yrs	15yrs
Severe Marine ISO cat. 4	N/R	10yrs	15yrs	N/R	15yrs	15yrs
Very Severe ISO cat. 5	N/R	N/R	10yrs	N/R	N/R	15yrs

Refer to the COLORCOTE® technical brochures for specific details on each product. COLORCOTE® products will inevitably weather, chalk, and fade over time as a result of normal wear and tear. The Environmental classifications are described in AS/NZS 2728 : 2007, and are as summarised in the Atmospheric Environment Usage Guide. Determination of coating performance will be as per test methods described in Australian Standard AS 1580. If any COLORCOTE® ZR8™, ZRX™, ZM8™, ZMX™, AR8™ or ARX™ product fails to perform as warranted we will, at our sole option, repair or replace (including labour) the affected material.

Please note this warranty is subject to the following general terms and conditions:

- This warranty will not apply to weathering, chalking or fading over time as a result of normal wear and tear.
- If the COLORCOTE® ZR8™, ZRX™, ZM8™, ZMX™, AR8™ and ARX™ product has not been selected, processed or maintained in accordance with the published recommendations of Pacific Coilcoaters and accepted good trade practices, this warranty will not apply.
- If inappropriate fastenings are used or incorrectly installed this warranty will not apply.
- Defects caused by faulty design, or method of manufacture of Residential Buildings are not covered by this warranty.
- Garage doors are not covered by this warranty.
- We must be given the opportunity for inspection on site prior to any remedial action being offered or taken.
- The product must be manufactured from prime COLORCOTE® pre-painted metal products.
- Damage or corrosion resulting from the following are not covered by this warranty:
 1. Damage sustained during handling, storage, processing, roll-forming or installation.
 2. Damage sustained after installation.
 3. Causes after the product has left our control.
 4. Failure to remove debris leading to the accumulation of moisture retaining matter on roofing or cladding and in gutters and downpipes.
 5. Failure to correctly maintain the roof and/or cladding.
 6. Damage caused by other items such as incorrect fasteners or incorrect installation, aerials, ducts, air conditioning etc.

Our liability under this warranty shall in all cases be limited to replacing or repairing the defective product as specified above including labour. Any repaired or replaced product will be covered by this warranty only for the unexpired portion of the warranty on the original product. Pacific Coilcoaters will not under any circumstances be liable for consequential loss or damage. All claims must be made promptly in writing and accompanied by the original warranty document. This warranty does not in any way affect the rights of a consumer under the Consumer Guarantees Act.

Minimum Maintenance Requirements

1. Washing of naturally unwashed areas at least every 6 months.
2. Removal of debris from gutters every 6 months.
3. Any noticeable buildup of salt deposits and/or other contaminants are removed when identified.
4. When considering overpainting please consult with your local distributor to ensure correct procedures are undertaken.
5. Inspection of the roof, including fasteners, repair any damage every 6 months.